## SEST AVAILABLE COPY

Claims 1-7 and 23-24 are now pending in the application. Claims 8-22 are cancelled by this amendment. Applicant has thoroughly reviewed the outstanding Office Action including the Examiner's remarks and the references cited therein. The following remarks are believed to be fully responsive to the Office Action, and to render all the claims at issue patentably distinguishable over the cited references.

Applicant note that the Office Action sent 5/04/04 indicates that only claims 1-22 are pending. Nevertheless, the response filed 2/5/04 added new claims 23 and 24. The Applicant requests that the indicate the addition of these claims and note them as pending in the application.

#### CLAIM REJECTIONS - 35 U.S.C. §103

Claims 1, 2, 5 and 6 stand rejected under 35 U.S.C. §103(a) as being unpatentable over Galligan et al. (U.S. Patent No. 5,422,331) in view of Deshpande et al. (U.S. Patent No. 6,110,439). Claims 1, 2, 3, 4, and 6 stand rejected under 35 U.S.C. §103(a) as being unpatentable over Rorabaugh et al. (U.S. Patent No. 5,958,583) in view of Meyer et al. (U.S. Patent No. 4,542,113). Claims 1-7 stand rejected under 35 U.S.C. §103(a) as being unpatentable over Butler et al. (U.S. Patent No. 6,497,776) in view of Meyer et al. (U.S. Patent No. 4,542,113) or Deshpande et al. (U.S. Patent No. 6,110,439).

Filed herewith is a Declaration under 37 CFR 1.131 executed by the inventor.

The Exhibits in the Declaration provide evidence of enough weight and character to show conception and/or reduction to practice of the claimed invention prior to the

effective dates of Deshpande et al., Rorabaugh et al., and Butler et al. Therefore, Deshpande et al., Rorabaugh et al., and Butler et al. can not be applied as proper prior art references to the pending claims. Also, as reasoned in previous responses the cited art, alone or in combination does not teach or reasonably suggest the elements of the pending claims. Therefore, the remaining references, alone or in combination, do not teach or fairly suggest each of the presently pending claims.

Therefore, each of the pending claims 1-7 and 23-24 are in condition for allowance. The Applicant requests that the Examiner withdraw each of the rejections and allow each of the pending claims.

#### CONCLUSION

It is believed that all of the stated grounds of rejection have been properly traversed, accommodated, or rendered moot. Applicant therefore respectfully requests that the Examiner reconsider and withdraw all presently outstanding rejections. It is believed that a full and complete response has been made to the outstanding Office Action, and as such, the present application is in condition for allowance. Thus, prompt and favorable consideration of this amendment is respectfully requested. Examiner believes that personal communication will expedite prosecution of this application, the Examiner is invited to telephone the undersigned at (248) 641-1600.

Date: 9/76/

HARNESS, DICKEY & PIERCE, P.L.C.

P.O. Box 828

Bloomfield Hills, MI 48303

(248) 641-1600

MLT/lki

Respectfully submitted.

Ŕéa. No. 50,52°

Attorney for Applicants





#### IN THE UNITED STATES PATENT AND TRADEMARK OFFICE

Application No.:

09/918,158

Filing Date:

July 30, 2001

Applicant:

Robert A. Dichiara Jr.

**Group Art Unit:** 

1731

Examiner:

Christopher A. Fiorilla

Title:

OXIDE BASED CERAMIC MATRIX COMPOSITES

**Attorney Docket:** 

7784-000146

Director of the United States Patent and Trademark Office P.O. Box 1450 Alexandria, VA 22313-1450

#### **DECLARATION UNDER 37 C.F.R. § 1.131**

Sir:

I hereby declare under penalty of perjury as follows:

- 1. That I am the sole inventor of the above-identified application.
- 2. That the invention was conceived and at least partially reduced to practice in this country prior to February 24, 1994, the filing date of the United States Patent No. 5,422,331 to Galligan et al. and prior to December 20, 1996, the filing date of the United States Patent No. 5,958,583 to Rorabaugh et al. In addition, this invention was


conceived and at least partially reduced to practice in this country prior to December 15, 1999, the filing date of United States Patent No. 6,497,776 to Butler et al., and prior to March 3, 1998, the filing date of United States Patent No. 6,110,439 to Deshpande et al.

- 3. I am the author of the notebook whose cover page is attached at Exhibit A. Pages from this notebook are attached as Exhibits B and C and the information contained within this notebook was either prepared by myself or under my direction.
- 4. That the invention was conceived and/or reduced to practice prior to February 25, 1994, as evidenced by the notebook page attached as Exhibit B. Exhibit B illustrates at least the initial conception and reduction to practice of a composition embodied by at least claim 1. A second page from the notebook is attached as Exhibit C and shows reduction to practice of a further embodiment of the invention claimed in at least claim 1 prior to February 25, 1994.
  - 5. That the invention has never been abandoned, suppressed, or concealed.
- 6. I hereby declare that all statements made herein of my own knowledge are true and that all statements made on information and belief are believed to be true; and further that these statements are being made with the knowledge that willful false statements and the like so made are punishable by fine or imprisonment, or both, under Section 1001 of Title 18 of the United States Code, and that such willful false

statements may jeopardize the validity of the application, and patent issuing thereon, or any patent to which this verified statement is directed.

Dated: 8/25/04

Robert A. Dichiara, Jr.

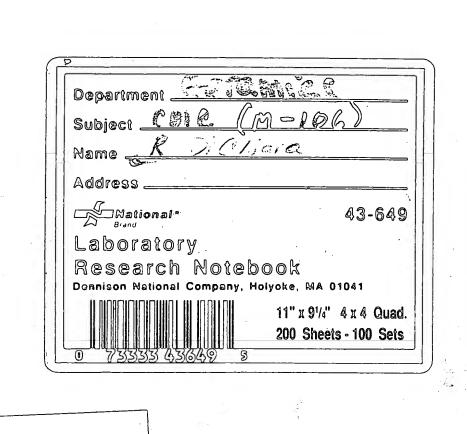

Charge #: IR-53704

	VARIABLES			
A	Mullite (Baikalox Submicron A)2O3/SiO2: 1.75)	Silica Sol/Mul	1.3	

LAMINATE SIZE: 6.5" (Warp direction) x 9.5" (Fill direction) untrimmed # Plies: 8

a) Heat clean a piece of 8HS Nicalon fabric 39" wide (Fill direction) by 13" long (Warp direction). b) Make up mix and use just after mixing or remix before use. Put 500 grams of Silica Sol (Nalco 2327) into the small ball mill and add 375 grams of submicron Baikalox Mullite (Al2O3/SiO2: 1.75) mix for 0.5 hours. Add 1.5 grams of Dow Corning antifoam 1410. Mix for 3.5 hours use mixture after this point. If observe foaming when opening up mill or viscosity not right for prepreging let Bob D. know. If cannot use that day, ball mill mixture again for 2 hours before use.

c) Hand prepreg the fabric try and achieve about 33 % fiber to matrix ratio and lay-up 8 wet plies

nested together, 6.5" (Warp direction) x 9.5". d) Fabric Wt. 127.7 g, Prepreg Wt. (actual) 307.1 g. Fiber/Matrix ratio = Fabric Wt./Prepreg Wt. (actual) x 100 = 41.6 %. Press cure the laminate

Apply 200 psi impredately and heat press to 200°F hold for 1/2 hour. Heat press to 220°F at 1°F/min and hold for 1/2 hour. Heat press to 350°F at 1°F/min. and hold for 1/2 hour. Remove laminate for post curing.

f) Post cure: To 1500° F/2 hr at 5 to 10° F/ minute.

g) Do physicals: % Porosity, % Matrix and % Fiber.

material

# > viscosity slumy

# 3 bleader package h) Cut laminate into flexure samples (0.5" x 5.5" [Warp direction]). May want to Reseat with HEO2 coast i) Heat treat samples placing samples into furnace at-temperature and remove to room temperature.

m) Test Samples:	Heat Treated	Testing Temperatu
4 Flexure	None	RT
4 Flexure 4 Flexure B Flexure	1500°F/1hr 2000°F/1hr 2000°F/1hr	1500°F 2000°F RT
COM AT ATTACK	700	

may want to try subar. mullite in phosphite Chamesty or well. See if Submicion is major effect.

There is a key

here for other work

or well. Good down

/ laminate. # Salmison

Progon - hold was proved Set of 180 until 7:50 pm. Went to 210 F for /2hm. Then to 425°F/1°F/min hold thour. on 10-7-93 7:30AM removed from

245° press. Panel Looked Excellent, uniform surface and . 105" thick scens hard. Post cured to 2000 for 2 hrs. Port hardens up within 5 minutes at 180° F Mixture putties-up after one duy in a closed container

#### Alum/Sol-I-2

DATE: 2-5-94

Charge #: IR-569030  VARIABLES  A Alumina (SM-8)  De Nextel 610 (alumina fiber)  LAMINATE SIZE: 6.5" (Warp direction) x 9.5" (Fill direction) untrimmed  # Plies: 8  a) Use heat cleaned Nextel 610 (8HS fabric) 39" wide (Fill direction) by 13" long (Warp direction).  b) Make up mixture and use just after mixing or remix just before use. Put 500 grams of Silica Sol (Nalco 2327) into the small ball mill and add 375 grams of submicron Baikalox SM-8 (Al2O3) mix for 0.5 hours. Add 1.5 grams of Dow Corning antifoam 1410. Mix for 3.5 hours use mixture after this point. If observe foaming when opening up mill add 0.5 grams of antifoam 1410, tumble for 5 minutes and record on sheet. If problems or viscosity not right for prepreging let Bob D. know. If cannot use that day, ball mill mixture again for 2 hours before use.  If slurry still appears good from Alum/Sol-I-1 you can use slurry again if you high shear at 5000 rpm's for 5 minutes (please make note on sheet of the material you used).  c) Hand prepreg the fabric try and achieve about 38-40 % fiber to matrix ratio and lay-up 8 wet plies nested together, 6.5" (Warp direction) x 9.5".  d) Fabric Wt. 108 S 200 S
LAMINATE SIZE: 6.5" (Warp direction) x 9.5" (Fill direction) untrimmed # Plies: 8 a) Use heat cleaned Nextel 610 (8HS fabric) 39" wide (Fill direction) by 13" long (Warp direction). b) Make up mixture and use just after mixing or remix just before use. Put 500 grams of Silica Sol (Nalco 2327) into the small ball mill and add 375 grams of submicron Baikalox SM-8 (A1203) mix for 0.5 hours. Add 1.5 grams of Dow Corning antifoam 1410. Mix for 3.5 hours use mixture after this point. If observe foaming when opening up mill add 0.5 grams of antifoam 1410, tumble for 5 minutes and record on sheet. If problems or viscosity not right for prepreging let Bob D. know. If cannot use that day, ball mill mixture again for 2 hours before use.  If slurry still appears good from Alum/Sol-I-1 you can use slurry again if you high shear at 5000 rpm's for 5 minutes (please make note on sheet of the material you used). c) Hand prepreg the fabric try and achieve about 38-40 % fiber to matrix ratio and lay-up 8 wet plies nested together, 6.5" (Warp direction) x 9.5". d) Fabric Wt. 103. g. g. Prepreg Wt. (actual) 2240.7 g. Fiber/Matrix ratio = Fabric Wt./Prepreg Wt. (actual) x 100 = 44.2 g. e) Make up cork dam set up with bleaderlease C on both sides like used in Mul-IV-1. f) Press cure the laminate, use one layer of armolon and one layer of pink release glass on both sides Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour. Heat press to 210°F at 1°F/min. and hold for 1 hour. Heat press to 425°F at 5°F/min. and hold for 1 hour. Heat press to 425°F at 5°F/min. and hold for 1 hour. Remove laminate for post curing. Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltarate with SiO2 Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfilitate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight
LAMINATE SIZE: 6.5" (Warp direction) x 9.5" (Fill direction) untrimmed # Plies: 8 a) Use heat cleaned Nextel 610 (8HS fabric) 39" wide (Fill direction) by 13" long (Warp direction). b) Make up mixture and use just after mixing or remix just before use. Put 500 grams of Silica Sol (Nalco 2327) into the small ball mill and add 375 grams of submicron Baikalox SM-8 (A1203) mix for 0.5 hours. Add 1.5 grams of Dow Corning antifoam 1410. Mix for 3.5 hours use mixture after this point. If observe foaming when opening up mill add 0.5 grams of antifoam 1410, tumble for 5 minutes and record on sheet. If problems or viscosity not right for prepreging let Bob D. know. If cannot use that day, ball mill mixture again for 2 hours before use.  If slurry still appears good from Alum/Sol-I-1 you can use slurry again if you high shear at 5000 rpm's for 5 minutes (please make note on sheet of the material you used). c) Hand prepreg the fabric try and achieve about 38-40 % fiber to matrix ratio and lay-up 8 wet plies nested together, 6.5" (Warp direction) x 9.5". d) Fabric Wt. 103. g. g. Prepreg Wt. (actual) 2240.7 g. Fiber/Matrix ratio = Fabric Wt./Prepreg Wt. (actual) x 100 = 44.2 g. e) Make up cork dam set up with bleaderlease C on both sides like used in Mul-IV-1. f) Press cure the laminate, use one layer of armolon and one layer of pink release glass on both sides Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour. Heat press to 210°F at 1°F/min. and hold for 1 hour. Heat press to 425°F at 5°F/min. and hold for 1 hour. Heat press to 425°F at 5°F/min. and hold for 1 hour. Remove laminate for post curing. Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltarate with SiO2 Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfilitate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight
a) Use heat cleaned Nextel 610 (8HS fabric) 39" wide (Fill direction) by 13" long (Warp direction). b) Make up mixture and use just after mixing or remix just before use. Put 500 grams of Silica Sol (Nalco 2327) into the small ball mill and add 375 grams of submicron Baikalox SM-8 (A12O3) mix for 0.5 hours. Add 1.5 grams of Dow Corning antifoam 1410. Mix for 3.5 hours use mixture after this point. If observe foaming when opening up mill add 0.5 grams of antifoam 1410, tumble for 5 minutes and record on sheet. If problems or viscosity not right for prepreging let Bob D. know. If cannot use that day, ball mill mixture again for 2 hours before use.  If slurry still appears good from Alum/Sol-I-1 you can use slurry again if you high shear at 5000 rpm's for 5 minutes (please make note on sheet of the material you used). c) Hand prepreg the fabric try and achieve about 38-40 % fiber to matrix ratio and lay-up 8 wet plies nested together, 6.5" (Warp direction) x 9.5". d) Fabric Wt. 10 - 2 - 3 - 441 - 7 g.  Fiber/Matrix ratio = Fabric Wt./Prepreg Wt. (actual) x 100 = -14 - 2 - 9. e) Make up cork dam set up with bleaderlease C on both sides like used in Mul-IV-1. f) Press cure the laminate, use one layer of amolon and one layer of pink release glass on both sides Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour. Heat press to 210°F at 1°F/min and hold for 1 hour. Remove laminate for post curing. g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltarate with SiO2 Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 126.5g, 1st infiltration 41.2 g, 2nd infiltration 14.3 - 7g, i)Fire panel to 2000°F for 2 hours. After firing g. k)Cut panel in half and dry at 220°F.
Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour. Heat press to 210°F at 1°F/min and hold for 1 hour. Heat press to 425°F at 5°F/min. and hold for 1 hour. Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltrarte with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times.  i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 136.5 g, 1st infiltration 141.2 g, 2nd infiltration 143.7 g, i) Fire panel to 2000°F for 2 hours. After firing g.  k) Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times.
Fiber/Matrix ratio = Fabric Wt./Prepreg Wt. (actual) x 100 = 4.2 %.  e) Make up cork dam set up with bleaderlease C on both sides like used in Mul-IV-1.  f) Press cure the laminate,     use one layer of armolon and one layer of pink release glass on both sides     Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour.     Heat press to 210°F at 1°F/min and hold for 1 hour.     Heat press to 425°F at 5°F/min. and hold for 1 hour.     Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 13625g, 1st infiltration 141.2 g, 2nd infiltration 143.7 Tg, j)Fire panel to 2000°F for 2 hours. After firing g. k)Cut panel in half and dry at 220°F. l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
Fiber/Matrix ratio = Fabric Wt./Prepreg Wt. (actual) x 100 = \( \frac{14.2}{9.0} \).  e) Make up cork dam set up with bleaderlease C on both sides like used in Mul-IV-1.  f) Press cure the laminate,     use one layer of armolon and one layer of pink release glass on both sides     Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour.     Heat press to 210°F at 1°F/min and hold for 1 hour.     Heat press to 425°F at 5°F/min. and hold for 1 hour.     Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute.  h) Reinfiltarate with SiO2 Sol. (Nalco 2327) 2 times.  i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made \( \frac{136}{260} \), 1st infiltration \( \frac{141.2}{260} \), 2g, 2nd infiltration \( \frac{143.7}{260} \), 7g,  j) Fire panel to 2000°F for 2 hours. After firingg.  k) Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO2 Sol. (Nalco 2327) for 2 more times
e) Make up cork dam set up with bleaderlease C on both sides like used in Mul-IV-1.  f) Press cure the laminate,     use one layer of armolon and one layer of pink release glass on both sides     Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour.     Heat press to 210°F at 1°F/min and hold for 1 hour.     Heat press to 425°F at 5°F/min. and hold for 1 hour.     Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 136.5 g, 1st infiltration 141.2 g, 2nd infiltration 143.7 g, j)Fire panel to 2000°F for 2 hours. After firing g. k)Cut panel in half and dry at 220°F. l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
use one layer of armolon and one layer of pink release glass on both sides Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour. Heat press to 210°F at 1°F/min and hold for 1 hour. Heat press to 425°F at 5°F/min. and hold for 1 hour. Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 1365 g, 1st infiltration 147.2 g, 2nd infiltration 143.7 g, j)Fire panel to 2000°F for 2 hours. After firing g. k)Cut panel in half and dry at 220°F. l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour.  Heat press to 210°F at 1°F/min and hold for 1 hour.  Heat press to 425°F at 5°F/min. and hold for 1 hour.  Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute.  h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times.  i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 1365g, 1st infiltration 141.2 g, 2nd infiltration 143.7g,  j)Fire panel to 2000°F for 2 hours. After firing g.  k)Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
Apply 200 psi immedately and heat press at 2°F.min. to 180°F hold for 1.5 hour.  Heat press to 210°F at 1°F/min and hold for 1 hour.  Heat press to 425°F at 5°F/min. and hold for 1 hour.  Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute.  h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times.  i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 1365g, 1st infiltration 141.2 g, 2nd infiltration 143.7g,  j)Fire panel to 2000°F for 2 hours. After firing g.  k)Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
Heat press to 210°F at 1°F/min and hold for 1 hour.  Heat press to 425°F at 5°F/min. and hold for 1 hour.  Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute.  h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times.  i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 136°5 g, 1st infiltration 141.2 g, 2nd infiltration 143.7 g,  j) Fire panel to 2000°F for 2 hours. After firing g.  k) Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
Remove laminate for post curing.  g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute.  h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times.  i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 1365 g, 1st infiltration 141.2 g, 2nd infiltration 143.7g,  j) Fire panel to 2000°F for 2 hours. After firing g.  k) Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
g) Post cure: To 2000°F/2 hr at 5 to 10°F/ minute. h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 1365 g, 1st infiltration 141.2 g, 2nd infiltration 143.7g, j) Fire panel to 2000°F for 2 hours. After firing g. k) Cut panel in half and dry at 220°F. l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
h) Reinfiltarate with SiO <sub>2</sub> Sol. (Nalco 2327) 2 times. i) Weigh panel to start and reinfiltate panel with Silica Sol under vacuum (30" Hg) for 30 min Remove panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 136.5 g, 1st infiltration 141.2 g, 2nd infiltration 143.7 g, j) Fire panel to 2000°F for 2 hours. After firing g. k) Cut panel in half and dry at 220°F. l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
panel from sol and place in oven at 300°F for 30 min Pull panel out of oven and when at room temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 136,5g, 1st infiltration 141.2g, 2nd infiltration 143.7g, j) Fire panel to 2000°F for 2 hours. After firing g. k) Cut panel in half and dry at 220°F.  1) Reinfiltrate half the panel with SiO2 Sol. (Nalco 2327) for 2 more times
temperature wipe off excessive silica powder off of surface and weigh. Repeat process 2 times. Weight as made 136.5g, 1st infiltration 141.2g, 2nd infiltration 143.7g, j) Fire panel to 2000°F for 2 hours. After firing g. k) Cut panel in half and dry at 220°F.  1) Reinfiltrate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
k)Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
k)Cut panel in half and dry at 220°F.  l) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
1) Reinfiltarate half the panel with SiO <sub>2</sub> Sol. (Nalco 2327) for 2 more times
m) Weigh panel to grow and mindless and mindless
m) Weigh panel to start and reinfiltate panel with Silica Sol
Weight as madeg, 3rd infiltration g 4th infiltration g
n) Fire panel to 2000°F for 2 hours. After firing
o) Do physicals: % Porosity, % Matrix and % Fiber.
p) Cut laminate into flexure samples (0.5" x 5.5"[Warp direction]).
q) Heat treat samples placing samples into furnace at-temperature and remove to room temperature.
r) Mechanical test both 2 and 4 times infiltarted panels.
Test Samples: Heat Treated Testing Temperature
4 Flexure None RT
4 Flexure 1800°F/1hr 1800°F
=GONIVIENTIS:
yilds 800 gus of slurry after ball milling

# This Page is Inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

### BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked.		
☐ BLACK BORDERS		
☐ IMAGE CUT OFF AT TOP, BOTTOM OR SIDES		
☐ FADED TEXT OR DRAWING		
☐ BLURRED OR ILLEGIBLE TEXT OR DRAWING		
☐ SKEWED/SLANTED IMAGES		
☐ COLOR OR BLACK AND WHITE PHOTOGRAPHS		
GRAY SCALE DOCUMENTS		
LINES OR MARKS ON ORIGINAL DOCUMENT		
☐ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY		
OTHER:		

## IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.